


# **951SX LONER** Temperature Controlled Soldering Station

- COMPLIES WITH MIL-S-45743E, MIL-STD-2000-1B, WS6536E AND ESD SPEC, DOD-STD-1686, DOD-HDBK-263
- UL listed

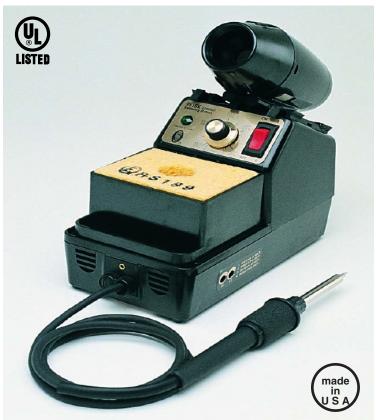


Instruction manual

## Specifications for Model 951SX

Power Requirements	120V, 60 Hz
Power Rating	15W - 220W
Heater Rating	120V, 95W
Temperature Range	400°F-800°F/205°C-427°C
Temperature Regulation	±6°F/±3°C
Tip-to-Ground Voltage Leakage/Resistance	< 2mV/< 2 ohms
Overall Dimension	4.1"W x 8.2"H x 10"D 104 mm x 208 mm x 254 mm
Weight	2.5 lbs/1.1 kg

### Contents

951SX includes	1 - LT375 Soldering Tip	
PD528	Tool Pod	
SH230	Sponge Holder (Includes RS199 Cleaning Sponge, RS243 Leveling Pad, LN230 Liner)	
WP556	WIGAPRY Low Static Computer Aid	

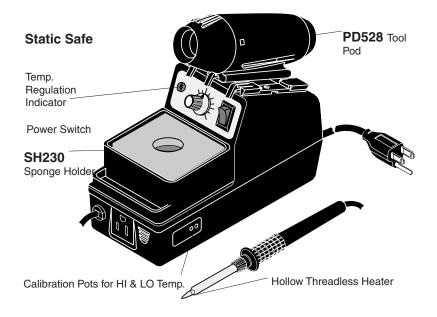


WARNING: DO NOT HIT OR TAP THE SOLDERING TOOL. THE HEATER ELEMENT WILL BREAK!!!

#### MAINTENANCE

#### • Replace RS199 Cleaning Sponge

**1.** Fill water only up to the top of the **RS243** Leveling Pad.

2. Depress RS199 to moisten it completely.

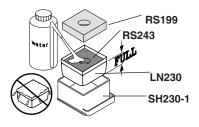

#### CAUTION:


Over-filling can cause thermal shock to the tip or heating element during tip cleaning.

#### Replace SC581 Solder Collector

**1.** Hold the Housing firm and turn Cap counter-clockwise and pull it away from the Housing.

**2.** Remove used **SC581** and replace with a new one.

**3.** Reassemble Pod with TOP of the Cap in proper position.




SR042 SC Thermal Solde Housing lee

Solder Col- Front Houslector ing

#### **TIP CLEANING**

To maintain proper Tip to Ground resistance.

- 1. Remove Tip from Heater Assembly.
- 2. Using a ST707 Soldering Tool Maintenance Brush, clean Tip and Heater Barrel at surfaces shown.
- **3.** Install the tip and tighten RS372 Retaining Sleeve. Take note of the gap to ensure proper fitting.




#### **TIP CARE**

- 1. Set desired temperature. Blinking Neon Lamp means Tool is ready.
- 2. TIN the Tip. (apply solder)
- 3. Do not rub, bend or reshape the Tip.
- 4. Always clean the Tip by wiping it against the saturated sponge and always RE-TIN.

#### **TEMPERATURE CALIBRATION**


- 1. Turn on power and set Temperature Control Knob to 400°F (205°C).
- **2.** Using a clean and well tinned Tip, apply a small amount of solder on the Tip, just enough to form a bead on top of the Tip.
- 3. Place the center of the thermocouple wire of the SDS100 on top of the bead.
- **4.** Again, apply a small amount of solder on the center of the thermo-couple wire, just enough to embed the center.
- 5. Adjust LO-Temp. Calibration Pot so the Meter will read 400°F (205°C).
- 6. Set Temperature Control Knob to 800°F (427°C).
- 7. Adjust Hi-Temp. Calibration Pot so the Meter will read 800°F (427°C).

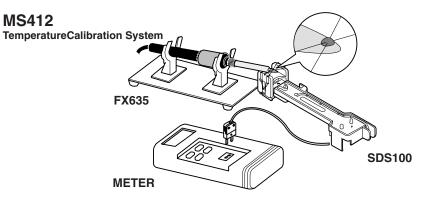


#### CHANGING TIP

DO NOT USE the soldering tool if soldering tip is loose. This will cause the heater element to break.


- 1. MAKE SURE YOUR TOOL IS COOL!
- 2. Turn Retaining Sleeve counter-clockwise to remove.
- 3. Remove old Soldering Tip.
- 4. Insert new Tip.
- 5. Install Retaining Sleeve. (should be "finger" tight only.)

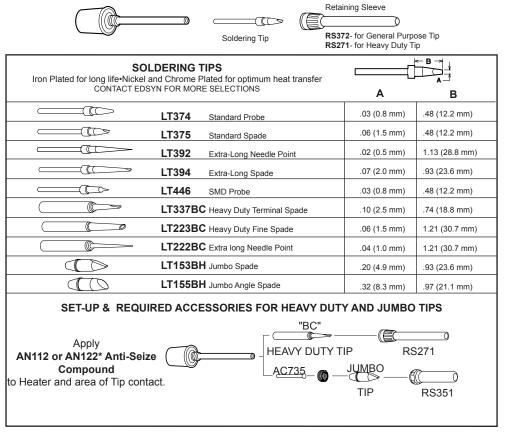

\*AN122 Anti-Seize Compound comes in syringe dispenser.




Fine point tip for SMD soldering.




Large and heavy tip for heavy duty soldering.

# 951SX LONER<sub>®</sub> SOLDERING STATION SPARE PARTS LIST

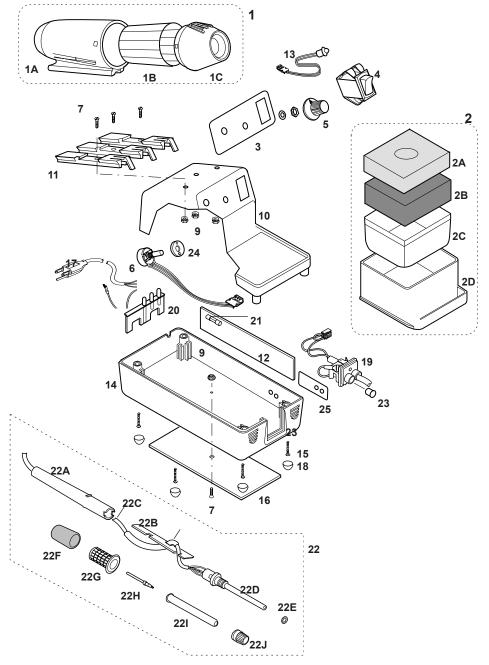

ITEM	PART NO.	DESCRIPTION	QTY
<u>NO.</u>	PD528	Tool Pod	REQ'D
1A	SR042	Thermal Housing for Tool Pod	1
1B	SC581	Solder Collector for Tool Pod	1
1C	SR043	Front Housing for Tool Pod	1
2	SH230	General Purpose Sponge Holder	1
2A	RS199	Cleaning Sponge	1
2B	RS243	Leveling Pad for SH230	1
2C	LN230	Liner for SH230	1
2D	SH230-1	Sponge Holder Tray	1
3	SR302	Control Panel Label	1
4	SR065	Power Switch, Illuminated	1
5	SR045	Knob, Temperature Control	1
6	SR243	5K Potentiometer, Temperature Control	1
7	SR015	Flat Head Screw- Slotted #6 - 32 x 1/2	4
9	SR017	Hex Nut- #6 - 32	4
10	SR741*	Top Case	1
11	SR019	Dove Tail Mount	1
12	15002W95	Circuit Board	1
13	SR573*	LED Assy.	1
14	SR052	Bottom Base	1
15	SR011	Pan Head Screw- Phillip #6 - 18 x 5/8	5
16	SR054	Bottom Weight	1
17	SR252	Power Cord Assy.	1
18	SR251	Rubber Foot	4
19	SR037	A/C Receptacle	1
20	SR241	Strain Relief for Power Cord	1
21	SR249	Fuse, 250V, 1.6 A (5mm x 20 mm)	1
22	SR298	Soldering Tool, Complete Assembly	1
22A	SR057	Handle for Tool	1
22B	SR058	Cord Strain Relief	1
22C	SR280	Tool Cord Assy., Burn Proof	1
22D	SR060	Heater Element Assembly Kit (O-Ring (22E) & Collar (22g) Included	1
22E	SR062	O-Ring	1
22F	SR063	Vinyl Sleeve	1
22G	SR064	Collar	1
22H	LT375	LONER <sub>®</sub> Standard Spade Tip	1
221	RS382	Retaining Sleeve	1
22J	RB386	Retaining Bushing	1
22K	SR525	Silicone Hose, Low Static (sold per foot)	5-1/4"
23	SR053	Strain Relief for Tool Cord	1
24	SR255	Spacer for Potentiometer	1
25	SR310	Label, Calibration Pot, Right Front or Left Rear	1

### 951SX instruction manual

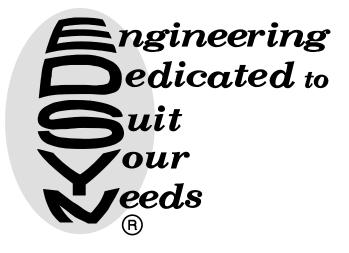

ALL RIGHTS RESERVED. NO PART OF THIS PUBLICATION INCLUDING THE INDIVIDUAL ICONS MAY BE REPRODUCED OR UTILIZED IN ANY FORM OR BY ANY MEANS WITHOUT THE PERMISSION OF EDSYN, INC.

THE NAMES LONER, SOLDAPULLT, SOLDAVAC, ATMOSCOPE AUTO-VAC, IDLE-REST, PIXTER, FUMINATOR, OCTAVAC AND KLATCH ARE REGISTERED TRADEMARKS OF EDSYN, INC.



MOST PRODUCTS ARE COVERED BY U.S. AND FOREIGN PATENTS AND PENDING APPLICATIONS.

Intellectual Property DESIGN, COLOR AND MATERIALS SUBJECT TO CHANGE WITHOUT NOTICE.

TIP STYLE ON SOLDERING, DESOLDERING AND HOT AIR TOOLS MAY VARY.

PRINTED IN U.S.A.



... the power of precision

15958 Arminta Street • Van Nuys • CA 91406-1896 Web Site www.edsyn.com • eMail info@edsyn.com